

TB 190

## TECHNICAL BULLETIN

### SAFETY ISSUE

<b>For the Attention of:</b>	Service Engineers, Installers, Trade Customers, Training Dept.
<b>Date:</b>	12 <sup>th</sup> December 2022
<b>Product:</b>	Stannah Midilift XL+
<b>Subject:</b>	Control unit front panel earth tab

---

**Originator:** Platform Division, Engineering Dept, Gate 1, Stannah Lifts Ltd, Watt Close, Andover, Hants SP10 3SD

---

### Introduction:

It has become apparent that some XL+ upper landing control unit front panels have been assembled without the earth stud (see Figure 1). If this panel remains unearthed there is an increased risk of an electric shock.

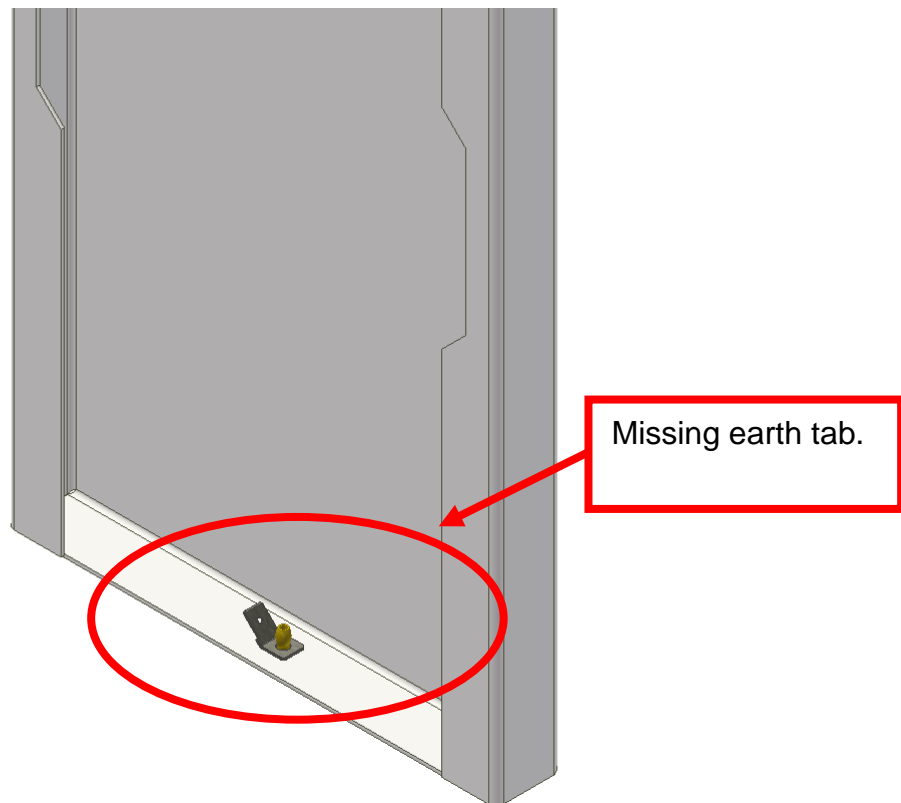


Figure 1

### Corrective Action:

If inspection of the control panel confirms that no earth tab has been fitted an earth tab retrofit kit can be ordered through Stannah lifts spares department under part number 950531.